

## Software Release Details

If your software is higher or equal to the versions listed below no action is needed.

Otherwise, please review this bulletin and consider taking actions as suggested. Do not install this version on non connect key devices.

System Software	CQ 8700/8900	CQ 93xx	WC 58xx	WC 7220/7225
System Software	072.161.104.14801	072.180.104.14801	072.190.124.23401	072.030.124.23401
Network Controller	072.164.14801	072.184.14800	072.194.23401	072.034.23401
User Interface	072.164.14800	071.184.14800	072.194.23401	072.034.23401
Marking Engine	004.004.046	020.011.018	096.063.000	018.001.000
Copy Controller	072.164.14801	072.184.14800	072.194.23401	072.034.23401
Document Feeder	010.062.000	025.021.048	110.011.018	012.003.000
Fax	003.011.011	003.011.008	003.011.020	003.011.014
Scanner	030.187.000	040.173.000	002.093.000	010.092.000
Software Upgrade	160.116.00292	180.116.00299	190.116.00293	030.116.00294

System Software	WC 7830/7835	WC 7845/7855	WC 7845/7855 XOM (Asian Market)
System Software	072.010.124.23401	072.040.124.23401	072.080.124.23401
Network Controller	072.014.23401	072.044.23401	072.084.23401
User Interface	072.014.23401	072.044.23401	072.084.23401
Marking Engine	090.029.000	090.079.000	096.054.000
Copy Controller	072.014.23401	072.044.23401	072.084.23401
Document Feeder	012.003.000	007.010.000	007.019.000
		007.019.000	
Fax	003.011.014	003.011.014	003.011.014
Scanner	004.092.000	008.092.000	008.088.000
Software Upgrade	010.116.00292	010.116.00294	010.116.00294

## Purpose

This Bulletin is ONLY intended for the specific security problem(s) identified below. The problem(s) identified has been rated as a criticality level of **IMPORTANT**:

- Security Vulnerabilities CVE-2011-4718 and CVE-2013-4248 when running HP WebInspect
- Security: Discovery-based products susceptible to CVE-2014-0224 (SSL/TLS MITM vulnerability)
- Retina detects SSL weak encryption. (Retina audit 11892)
- Open SSL CVE-2014-0160 Must upgrade to OpenSSL version 0.9.8za or 1.0.1h
- Omnikey card reader 3021 has revision that does not work, no response when card swiped

## Installation Notes

WC 7845/7855 models require a separate pre-upgrade patch which is located in the product link below. This patch is provided to ensure the scanner software completes correctly. Failure to use the pre-upgrade patch on the WC 7845/55 may result in the device taking longer to upgrade and experience extra reboots during the process.

### **Firmware Release File**

Release Install File	072.xxx.124.23401 or higher
----------------------	-----------------------------

The SPAR Software and installation notes are located here:

[87xxsoftware](#)

[93xxsoftware](#)

[58xxsoftware](#)

[72xxsoftware](#)

[7830-35software](#)

[7845-55software](#)

Save the file to a convenient location on your workstation. Unzip the file if necessary.